

TC77^{ex}-NI Accessories

Datasheet

Kreski

Zapraszamy do kontaktu!
Więcej informacji: www.kreski.pl



It is absolutely necessary to use original accessories from BARTEC!

Accessories for use in potentially explosive atmospheres

Accessories are approved for:

- ATEX: Zone 2/22 (EPS 17 ATEX 1 028 X)
- IECEx: Zone 2/22 (IECEx EPS 17.0012X)
- NEC: Class I,II, III Div 2 (ETL File 5012876)



Battery

Description	<ul style="list-style-type: none">- certified in combination with TC77^{EX}-NI- Lithium-ion battery 3.7 V/4620 mAh May only be changed and charged outside the potentially explosive atmosphere!
-------------	---

Order no.	B7-A2Z0-0072
-----------	--------------



Scan handle

Description	<ul style="list-style-type: none">- certified in combination with TC7x series- Simple assembly and disassembly without tools- Camera and expansion interface remain usable- Hand strap can remain on the device- Holder for stylus- Charging with mounted scan handle in base station not possible, only in the charging station Must be changed only outside potentially explosive atmosphere!
-------------	--

Order no.	B7-A2Z0-0052
-----------	--------------



Leather holster

Description	<ul style="list-style-type: none">- certified in combination with TC7x series- Holder for stylus
-------------	---

Order no.	B7-A2Z0-0057
-----------	--------------

Accessories for use in potentially explosive atmospheres




Leather carry case

Description	<ul style="list-style-type: none">– certified in combination with TC7x series– Robust leather in industrial quality– Holder for stylus– Included belt clip
-------------	---

Must be changed only outside potentially explosive atmosphere!

Order no.	B7-A2Z0-0073
-----------	--------------

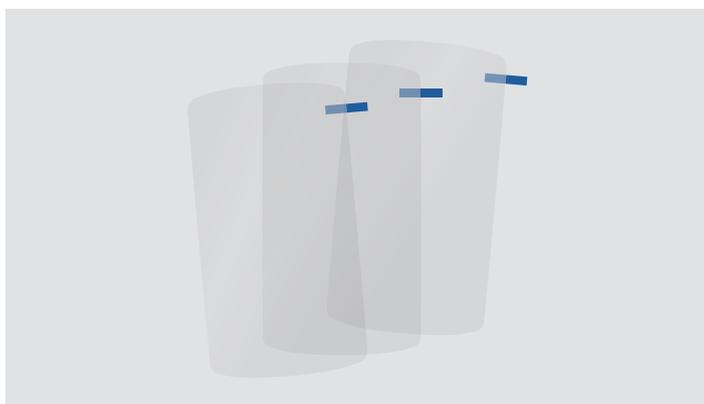

Screen protector

Description	<ul style="list-style-type: none">– certified in combination with TC7x series– 3 pieces
-------------	--

Must be changed only outside potentially explosive atmosphere!

Order no.	B7-A2Z0-0051
-----------	--------------

Zapraszamy do kontaktu!
Więcej informacji: www.kreski.pl

Accessories for use outside potentially explosive atmospheres



4-slot battery charging station

- | | |
|-------------|---|
| TC 75Xex-NI | <ul style="list-style-type: none"> - Charging four batteries - Charging display via LED |
|-------------|---|

- | | |
|---------------|--|
| Also required | (not included in the delivery) <ul style="list-style-type: none"> - Power supply with DC connecting cable - AC power cable |
|---------------|--|

TC 75Xex-NI	G7-A0Z0-0020
-------------	--------------



Base station

- | | |
|-------------|--|
| Description | <ul style="list-style-type: none"> - Charging the Touch Computer (only possible without scan handle) - Charging a spare battery - Data communication <ul style="list-style-type: none"> 1x USB 1x Ethernet |
|-------------|--|

- | | |
|---------------|--|
| Also required | (not included in the delivery) <ul style="list-style-type: none"> - Power supply with DC connecting cable - AC power cable - Micro USB cable for data synchronization |
|---------------|--|

Order no.	G7-A0Z0-0022
-----------	--------------



Charging station

- | | |
|-------------|--|
| Description | <ul style="list-style-type: none"> - Charging the Touch Computer (also possible with scan handle) - Charging a spare battery |
|-------------|--|

- | | |
|---------------|--|
| Also required | (not included in the delivery) <ul style="list-style-type: none"> - Power supply with DC connecting cable - AC power cable |
|---------------|--|

Order no.	G7-A0Z0-0048
-----------	--------------



USB adapter cable

- | | |
|-------------|---|
| Description | <ul style="list-style-type: none"> - Charging the Touch Computer - Data synchronization via USB |
|-------------|---|

- | | |
|---------------|---|
| Also required | (not included in the delivery) <ul style="list-style-type: none"> - Power supply for USB adapter cable - AC power cable |
|---------------|---|

Order no.	G7-A0Z0-0037
-----------	--------------



Power supply

- | | |
|-------------|--|
| Description | <ul style="list-style-type: none">- with DC connecting cable- for 4-slot battery charging station and base station- Input voltage: AC 100 V to 240 V- Output voltage: DC 12 V/4,16 A/50 W |
|-------------|--|

Order no.	G7-A0Z0-0023
-----------	--------------



Power supply

- | | |
|-------------|--|
| Description | <ul style="list-style-type: none">- for USB adapter cable- Including DC connecting cable- Input voltage: AC 100 V to 240 V- Output voltage: DC 5.4 V/3 A/16 W |
|-------------|--|

Order no.	G7-A0Z0-0038
-----------	--------------



Micro USB cable

- | | |
|-------------|--|
| Description | <ul style="list-style-type: none">- for base station- for data synchronization- USB (A) to micro USB (B) |
|-------------|--|

Order no.	03-9919-0013
-----------	--------------



Zapraszamy do kontaktu!
Więcej informacji: www.kreski.pl



AC power cable

Description

- suitable for power supply with DC connection cable
- 3-wire
- country-specific

Order no.	US + Canada	G7-A0Z0-0024
	EU + APAC	G7-A0Z0-0026
	Taiwan	G7-A0Z0-0027

Please purchase the required country-specific cables in the respective country!



AC power cable

Description

- suitable for power supply for USB adapter cable
- 3-wire
- country-specific

Order no.	US + Canada	G7-A0Z0-0032
	EU + APAC	G7-A0Z0-0034

Please purchase the required country-specific cables in the respective country!



Zapraszamy do kontaktu!
Więcej informacji: www.kreski.pl